

Port Jefferson Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20810

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

Performed for:

**Port Jefferson Union Free School District
550 Scraggy Hill Road
Port Jefferson, NY 11777**

May 2021

Prepared by:

**Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191**

Project #20810

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Edna Louise Spear Elementary School

Appendix B – Port Jefferson Middle School

Appendix C – Earl L. Vandermeulen High School

Appendix D– Technology Education Building

Appendix E– Administration Building

Appendix F – Field House

May 27, 2021

Fred Koelbel
Port Jefferson Union Free School District
550 Scraggy Hill Road
Port Jefferson, NY 11777

I. Executive Summary

The Port Jefferson Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Port Jefferson Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains, water coolers and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics and Culinary Arts classroom sinks
- 5) Elementary Classroom Sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by EnviroScience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Port Jefferson Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Port Jefferson Union Free School District on May 18 and 19, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

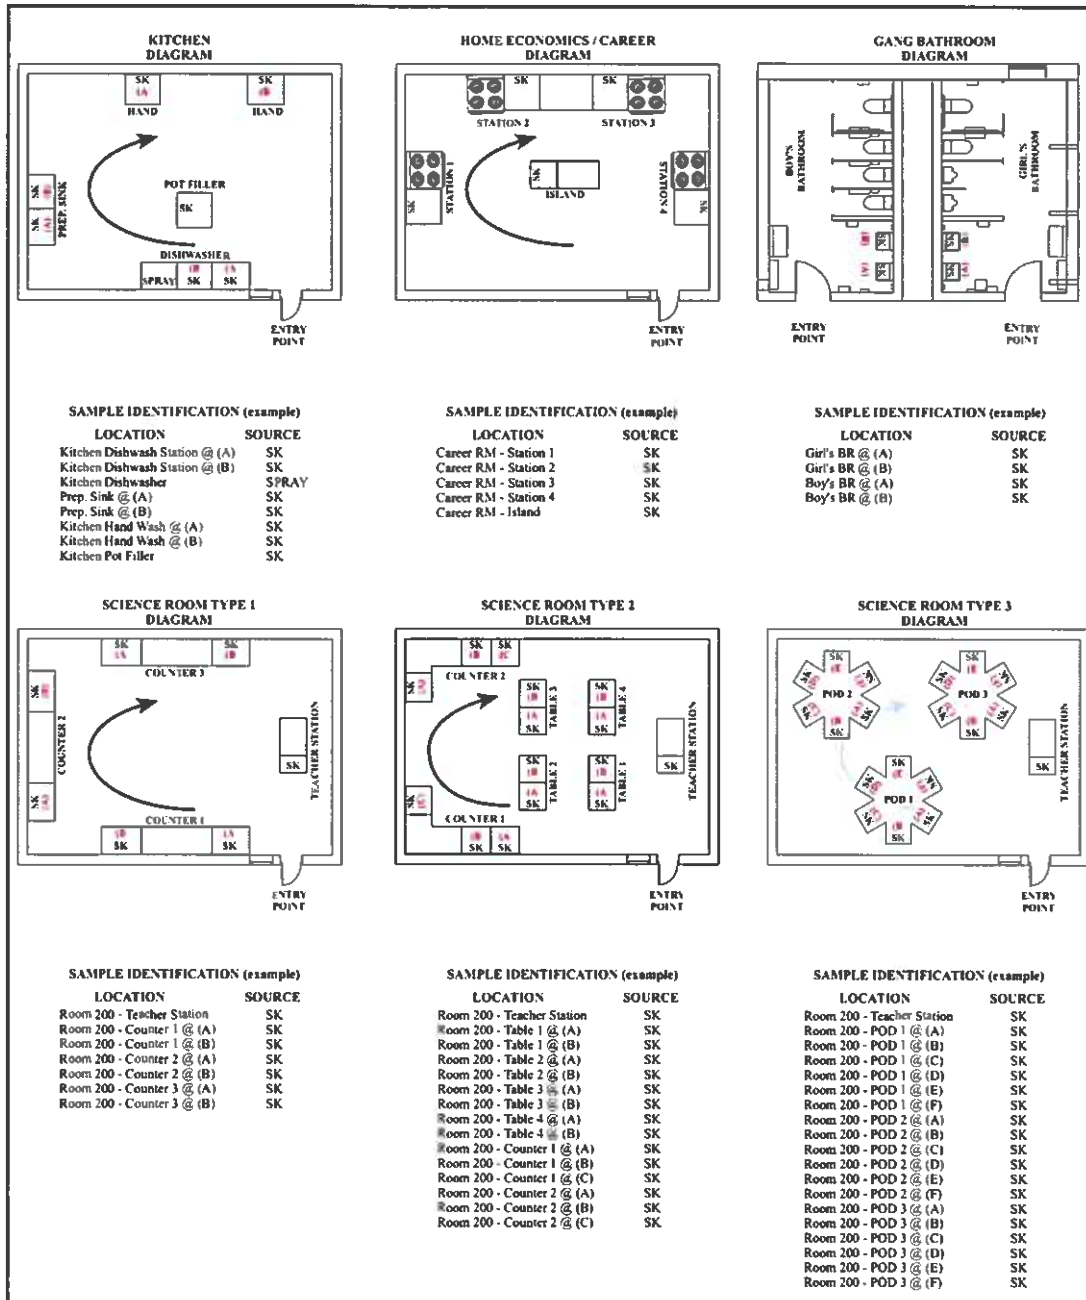

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Edna Louise Spear Elementary School

Kitchen Pot Filler Hose	PF	329
Kitchen Dishwash	SPY	46.7

Administration Building

Kitchenette in Vestibule	SK	16
Main Office Kitchen	SK	30.2

Field House

Exterior Hose Bib by Boiler Room	HB	55.6
----------------------------------	----	------

Appendix A

Port Jefferson UFSD
Edna Louise Spear Elementary School

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1001-2	Kitchen Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1001-3	Kitchen Handwash	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1001-4	Kitchen 3-Bay - Left	SK	App	2.98	5/19/2020	-	-	-	None	-	-	-
1001-5	Kitchen 3-Bay - Middle	SK	App	3.73	5/19/2020	-	-	-	None	-	-	-
1001-6	Kitchen 3-Bay - Right	SK	App	3.53	5/19/2020	-	-	-	None	-	-	-
1001-7	Kitchen Pot Filler Hose	PF	App	329	5/19/2020	-	-	-	None	Removed from service	-	-
1001-8	Kitchen Island Prep	SK	App	4.3	5/19/2020	-	-	-	None	-	-	-
1001-9	Kitchen Dishwash	SPY	App	41.1	6/3/2021	3.2	4.87	6/3/2021	None	Permanent Sign Posted	-	-
1002-1	Gym	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1003-1	Boy's Coach's Office Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1004-1	All Purpose Room-Trough @A	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1004-2	All Purpose Room-Trough @B	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1004-3	All Purpose Room-Trough @C	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1004-4	All Purpose Room	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1004-5	All Purpose Room	BF	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1005-1	Girl's Coach's Office Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1006-1	Science Room @A	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1006-2	Science Room @B	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1006-3	Science Room @C	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-1	Custodial Closet by Room 409	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1008-1	Bathroom by Room 515	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1009-1	Room 506B Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1010-1	Room 505	SK	App	1.88	5/19/2020	-	-	-	None	-	-	-
1010-2	Room 505	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1011-1	Room 504	SK	App	6.4	5/19/2020	-	-	-	None	-	-	-
1011-2	Room 504	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1012-1	Room 503	SK	App	3.66	5/19/2020	-	-	-	None	-	-	-
1012-2	Room 503	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1013-1	Room 513	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1013-2	Room 513	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1014-1	Room 502	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1014-2	Room 502	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1015-1	Room 512	SK	App	1.84	5/19/2020	-	-	-	None	-	-	-
1015-2	Room 512	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1016-1	Pool Pump Room	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1017-1	Hallway by Pool Pump Room	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1017-2	Hallway by Pool Pump Room	BF	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1018-1	Boy's Dressing Room	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1018-2	Boy's Dressing Room Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-1	Pool Office-Left Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1020-1	Pool Office-Right Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1021-1	Girl's Dressing Room	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1021-2	Girl's Dressing Room Bathroom @A	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1021-3	Girl's Dressing Room Bathroom @B	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1022-1	Laundry Room	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1023-1	Boiler Room Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1024-1	Room 409	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1024-2	Room 409	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1025-1	Room 410	SK	App	3.08	5/19/2020	-	-	-	None	-	-	-
1025-2	Room 410	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1026-1	Room 401	SK	App	1.56	5/19/2020	-	-	-	None	-	-	-
1026-2	Room 401	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1027-1	Room 411	SK	App	1.09	5/19/2020	-	-	-	None	-	-	-
1027-2	Room 411	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1028-1	Room 402	SK	App	1.02	5/19/2020	-	-	-	None	-	-	-
1028-2	Room 402	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1029-1	Library Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1030-1	Teacher Resource Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1031-1	Room 403	SK	App	1.31	5/19/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-2	Room 403	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1032-1	Room 404	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1032-2	Room 404	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1033-1	Room 414	SK	App	1.04	5/19/2020	-	-	-	None	-	-	-
1033-2	Room 414	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1034-1	Room 405	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1034-2	Room 405	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1035-1	Room 415	SK	App	1.09	5/19/2020	-	-	-	None	-	-	-
1035-2	Room 415	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1036-1	Room 406	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1036-2	Room 406	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1037-1	Room 416	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1037-2	Room 416	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1038-1	Faculty Room	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1038-2	Faculty Room	SPY	App	7.21	5/19/2020	-	-	-	None	-	-	-
1038-3	Faculty Room-Hard Wired	WC	App		5/19/2020	-	-	-	None	-	-	-
1039-1	Men's Faculty Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1040-1	Hallway by Xerox Room	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1041-2	Handicap Bathroom by Xerox Room	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1042-1	Music Office Off of Stage	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-1	Women's Faculty Bathroom by Tech Center	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1044-1	Art Room 301 @A	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1044-2	Art Room 301 @B	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1045-1	Art Room 302 @A	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1045-2	Art Room 302 @B	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1046-1	Room 303	SK	App	3.19	5/19/2020	-	-	-	None	-	-	-
1046-2	Room 303	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1047-1	Room 304	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1047-2	Room 304	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1048-1	Room 305	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1048-2	Room 305	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1049-1	Room 306	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1049-2	Room 306	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1050-1	Room 206-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1050-2	Room 206-Right	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1050-3	Room 206	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1051-1	Room 205-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1051-2	Room 205-Right	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1051-3	Room 205	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1052-1	Room 204-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1052-2	Room 204-Right	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1052-3	Room 204	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1053-1	Room 203-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1053-2	Room 203-Right	SK	App	1.29	5/19/2020	-	-	-	None	-	-	-
1053-3	Room 203	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1054-1	Room 202-Left	SK	App	1.5	5/19/2020	-	-	-	None	-	-	-
1054-2	Room 202-Right	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1054-3	Room 202	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1055-1	Room 201-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1055-2	Room 201-Right	SK	App	1.5	5/19/2020	-	-	-	None	-	-	-
1055-3	Room 201	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1056-1	Principal's Office Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1057-1	Main Office	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1058-1	Main Office Custodial Closet	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1059-1	Health Office Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1059-2	Health Office-Left	SK	App	1.45	5/19/2020	-	-	-	None	-	-	-
1059-3	Health Office-Right	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1059-4	Health Office	WC	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1060-1	Room 101-Left	SK	App	2.19	5/19/2020	-	-	-	None	-	-	-
1060-2	Room 101-Right	SK	App	3.41	5/19/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1060-3	Room 101	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1060-4	Room 101 Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1061-1	Room 102-Left	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1061-2	Room 102-Right	SK	App	2.15	5/19/2020	-	-	-	None	-	-	-
1061-3	Room 102	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1061-4	Room 102 Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1062-1	Room 103	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1062-2	Room 103	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1063-1	Room 104	SK	App	1.2	5/19/2020	-	-	-	None	-	-	-
1063-2	Room 104	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1064-1	Room 105	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1064-2	Room 105	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-
1065-1	Room 106	SK	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1065-2	Room 106	WF	App		5/19/2020	-	-	-	None	Removed from service	-	-

Appendix B

Port Jefferson UFSD
Port Jefferson Middle School
School Water Outlet Inventory
Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Hallway by Trainer's Room	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1001-2	Hallway by Trainer's Room	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1002-1	Men's Bathroom by Trainer's Office @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1002-2	Men's Bathroom by Trainer's Office @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-1	Faculty Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-1	Hallway by Faculty Bathroom	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1005-1	Boy's Locker Room-Custodial Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-2	Boy's Locker Room Bathroom @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-3	Boy's Locker Room Bathroom @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-1	Boy's Locker Room Vestibule	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1007-1	Boy's Coach's Office Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-1	Boy's Locker Room Vestibule-Custodial Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2001-1	Women's Bathroom-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2001-2	Women's Bathroom-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2001-3	Women's Bathroom-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2002-1	Multipurpose Room Vestibule-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2002-2	Multipurpose Room Vestibule-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2002-3	Multipurpose Room Vestibule-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2003-1	Kitchen	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
2003-2	Kitchen	SPY	App	<1.0	5/18/2021	-	-	-	None	-	-	-

Port Jefferson UFSD
Port Jefferson Middle School
School Water Outlet Inventory
Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-1	Hallway by Room A111	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
2005-1	Boy's Bathroom by Room 110 Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2005-2	Boy's Bathroom by Room 110 Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2005-3	Boy's Bathroom by Room 110 Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2005-4	Boy's Bathroom-Custodial Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2006-1	Girl's Bathroom by Room A108 @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2006-2	Girl's Bathroom by Room A108 @B	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-1	Room A104-Art-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-2	Room A104-Art-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-3	Room A104-Art-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-4	Room A104-Art-Trough @D	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-5	Room A104-Art-Trough @E	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-6	Room A104-Art-Trough @F	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2008-1	Room A105-Home Economics Counter @A	SK	App	2.3	5/18/2021	-	-	-	None	-	-	-
2008-2	Room A105-Home Economics Counter @B	SK	App	4.06	5/18/2021	-	-	-	None	-	-	-
2008-3	Room A105-Home Economics Counter @C	SK	App	6.75	5/18/2021	-	-	-	None	-	-	-
2008-4	Room A105-Home Economics Counter @D	SK	App	2.08	5/18/2021	-	-	-	None	-	-	-
2008-5	Room A105-Home Economics Counter @E	SK	App	2.36	5/18/2021	-	-	-	None	-	-	-
3001-1	Men's Bathroom by Faculty Room	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3002-1	Faculty Room Kichenette	SK	App	2.66	5/18/2021	-	-	-	None	-	-	-

Port Jefferson UFSD
Port Jefferson Middle School
School Water Outlet Inventory
Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3002-2	Faculty Room Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3003-1	Custodial Closet by Room A211	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3004-1	Hallway by Room A210	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
3005-1	Room A209-Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3005-2	Room A209-Counter @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3005-3	Room A209-Counter @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3005-4	Room A209-Prep Room	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-1	Room A207-Teacher's Station @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-2	Room A207-Teacher's Station @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-3	Room A207-Counter @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-4	Room A207-Counter @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-5	Room A207-Counter @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-6	Room A207-Counter @D	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-7	Room A207-Counter @E	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3006-8	Room A207-Counter @F	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3007-1	Room A206-Counter @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3007-2	Room A206-Counter @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3007-3	Room A206-Counter @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3007-4	Room A206-Counter @D	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-



Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Boiler Room	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-01	Kitchen Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-02	Kitchen 3-Bay Left	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1001-03	Kitchen 3-Bay Right	SK	App	3.95	5/18/2021	-	-	-	None	-	-	-
1001-04	Kitchen Handwash	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-05	Kitchen	PF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1001-06	Kitchen Island	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1001-07	Kitchen Island Handwash	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1002-01	Women's Bathroom by Kitchen Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1002-02	Women's Bathroom by Kitchen Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-01	Custodial Closet by Kitchen	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-01	Men's Bathroom by Kitchen	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-01	Room 404 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-02	Room 404 Counter	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-03	Room 404 Table 1 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-04	Room 404 Table 1 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-05	Room 404 Table 2 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-06	Room 404 Table 2 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-07	Room 404 Table 3 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1005-08	Room 404 Table 3 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-01	Room 403 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-02	Room 403 Counter 1	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-03	Room 403 Counter 2	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-04	Room 403 Pod 1 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-05	Room 403 Pod 1 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-06	Room 403 Pod 2 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-07	Room 403 Pod 2 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-08	Room 403 Prep Room	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-01	Room 405 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-02	Room 405 Counter	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-03	Room 405 Pod 1 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-04	Room 405 Pod 1 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-05	Room 405 Pod 2 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-06	Room 405 Pod 2 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-01	Room 408 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-02	Room 408 Counter 1	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-03	Room 408 Counter 2	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-04	Room 408 Counter 3	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-05	Room 408 Pod 1 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-06	Room 408 Pod 1 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-07	Room 408 Pod 2 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-08	Room 408 Pod 2 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-09	Room 408 Pod 3 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-10	Room 408 Pod 3 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-11	Room 408 Pod 4 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-12	Room 408 Pod 4 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-13	Room 408 Pod 5 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-14	Room 408 Pod 5 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-15	Room 408 Pod 6 @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-16	Room 408 Pod 6 @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-01	Room 407 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1010-01	Cafeteria	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1010-02	Cafeteria	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1011-01	Room 401 Teacher's Station	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-02	Room 401 Counter 1	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-03	Room 401 Counter 2 Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-04	Room 401 Counter 2 Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-05	Room 401 Pod @ A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-06	Room 401 Pod @ B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1011-07	Room 401 Pod @ C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-01	Hall by Main Office	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1013-01	Conference Room	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1013-02	Conference Room	OS	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1014-01	Men's Bathroom by Main Office Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1014-02	Men's Bathroom by Main Office Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1015-01	Room 115	SK	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1016-01	Women's Bathroom by Room 116 Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1016-02	Women's Bathroom by Room 116 Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1017-01	Auditorium Stage	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1018-01	Girl's Coach's Office Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1019-01	Girl's Locker Room	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1019-02	Girl's Locker Room Closet	HB	App	7.93	5/18/2021	-	-	-	None	-	-	-
1019-03	Girl's Locker Room Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1019-04	Girl's Locker Room Bathroom Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1019-05	Girl's Locker Room Bathroom Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1020-01	Boy's Coach's Office Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1020-02	Boy's Locker Room Vestibule	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
1020-03	Boy's Locker Room Vestibule Closet	SS	App	5.24	5/18/2021	-	-	-	None	-	-	-
1020-04	Boy's Locker Room Closet	HB	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1020-05	Boy's Locker Room Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-06	Boy's Locker Room Bathroom Left	SK	N/A		5/18/2021				None	SIGN	-	-
1020-07	Boy's Locker Room Bathroom Right	SK	N/A		5/18/2021				None	SIGN	-	-
1021-01	Hall by Gym Boy's Side	BF	App	<1.0	5/18/2021				None	-	-	-
1021-02	Hall by Gym Boy's Side	WF	App		5/18/2021				None	Removed from service	-	-
1022-01	Men's Bathroom by Gym Left	SK	N/A		5/18/2021				None	SIGN	-	-
1022-02	Men's Bathroom by Gym Right	SK	N/A		5/18/2021				None	SIGN	-	-
1023-01	Hall by Gym Girl's Side	BF	App	<1.0	5/18/2021				None	-	-	-
1023-02	Hall by Gym Girl's Side	WF	App		5/18/2021				None	Removed from service	-	-
1023-03	Hall by Gym	IM	App	<1.0	5/18/2021				None	-	-	-
1023-04	Gym Lobby Closet Spigot	SP	App	5.75	9/10/2021							
1024-01	Nurse's Office	SK	App	<1.0	5/18/2021				None	-	-	-
1024-02	Nurse's Office Bathroom	SK	App	<1.0	5/18/2021				None	-	-	-
1025-01	Girl's Bathroom by Gym Left	SK	N/A		5/18/2021				None	SIGN	-	-
1025-02	Girl's Bathroom by Gym Right	SK	N/A		5/18/2021				None	SIGN	-	-
2001-01	Team Room Coach's Office Bathroom	SK	N/A		5/18/2021				None	SIGN	-	-
2001-02	Team Room Custodial Closet	SS	N/A		5/18/2021				None	SIGN	-	-
2001-03	Team Room	WF	App		5/18/2021				None	Removed from service	-	-
2001-04	Team Room Bathroom Left	SK	N/A		5/18/2021				None	SIGN	-	-
2001-05	Team Room Bathroom Right	SK	N/A		5/18/2021				None	SIGN	-	-
2002-01	Fitness Center	OS	App	<1.0	5/18/2021				None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-01	Hall by Room 218	WF	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2004-01	Custodial Closet by Elevator Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2005-01	Hall by Room 213	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
2006-01	Library	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2006-02	Library Office	SK	App	5.31	5/18/2021	-	-	-	None	-	-	-
2007-01	Girl's Bathroom by Room 208 Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2007-02	Girl's Bathroom by Room 208 Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2008-01	Custodial Office Closet	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2008-02	Custodial Office Break Room	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
2008-03	Custodial Office Break Room	OS	App	<1.0	5/18/2021	-	-	-	None	-	-	-
3001-01	Boy's Bathroom by Book Room Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3001-02	Boy's Bathroom by Book Room Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3002-01	Custodial Closet by Book Room	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3003-01	Hall by Room 305	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
3003-02	Hall by Room 305	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
3004-01	Faculty Room Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3005-01	Girl's Bathroom by Room 309 Left	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
3005-02	Girl's Bathroom by Room 309 Right	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-

Appendix D

Port Jefferson UFSD
Technical Center

School Water Outlet Inventory

Lead in School Drinking Water Program 2020-2021

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Wrestling Coach's Office	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
0001-2	Wrestling Coach's Office	WF	App		5/18/2021	-	-	-	None	Removed from service	-	-
0002-1	Wrestling Coach's Office Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
0002-2	Wrestling Coach's Office Bathroom	SS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-1	Wood Lab	BF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1001-2	Wood Lab	WF	App	<1.0	5/18/2021	-	-	-	None	-	-	-
1001-3	Wood Lab @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-4	Wood Lab @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1001-5	Wood Lab @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1002-1	Wood Lab Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-1	Ceramics @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-2	Ceramics-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-3	Ceramics-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1003-4	Ceramics-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-1	Ceramics-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-2	Ceramics-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-3	Ceramics-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1004-4	Ceramics	WF	N/A	5.07	5/18/2021	-	-	-	None	SIGN	-	-
1005-1	Ceramics Bathroom	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1006-1	Dark Room-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Dark Room-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1007-1	Dark Room-Hose Bib	OS	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1008-1	Photo Room	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-1	Art Room-Trough @A	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-2	Art Room-Trough @B	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-3	Art Room-Trough @C	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-4	Art Room-Trough @D	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-5	Art Room-Trough @E	SK	N/A		5/18/2021	-	-	-	None	SIGN	-	-
1009-6	Art Room-Trough @F	SPY	N/A		5/18/2021	-	-	-	None	SIGN	-	-

Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen in Vestibule	SK	App	33.4	6/3/2021	<1.0	<1.0		FR	Fixture Replacement	6.28	9/10/2021
1001-2	Kitchen in Vestibule	SPY	App	4.89	9/10/2021							
1002-1	Women's Bathroom	SK	N/A		5/19/2021			-	None	SIGN		
1003-1	Men's Bathroom	SK	N/A		5/19/2021			-	None	SIGN		
1004-1	Main Office Kitchen	SK	App	30.2	5/19/2021	2.27	2.65	6/3/2021	FR	Fixture Replacement	1.84	6/3/2021
1005-1	Secretary Office Bathroom	SK	N/A		5/19/2021			-	None	SIGN		
1006-1	Superintendent's Office Bathroom	SK	N/A		5/19/2021			-	None	SIGN		
1007-1	Secretary Business Main Office Kitchenette	SK	App	2.68	5/19/2021			-	None			
1008-1	Main Secretarial Office-Hard Wired	WC	App	<1.0	5/19/2021			-	None			
1009-1	Conference Room-Hard Wired	WC	App	<1.0	5/19/2021			-	None			
1010-1	Secretary Business Main Office-Hard Wired	WC	App	<1.0	5/19/2021			-	None			

Appendix F

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchenette-Hard Wired	WC	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1002-1	Boiler Room	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1003-1	Men's Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1004-1	Women's Bathroom	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1005-1	Locker Room	WF	App		5/19/2020	-	-	-	None	Removed from Service	-	-
1006-1	Boy's Locker Room	WF	App		5/19/2020	-	-	-	None	Removed from Service	-	-
1006-2	Boy's Locker Room Bathroom - Left	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1006-3	Boy's Locker Room Bathroom - Right	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1006-4	Boy's Locker Room Coach's Office	IM	App	<1.0	5/19/2020	-	-	-	None	-	-	-
1006-5	Boy's Locker Room Coach's Office	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1007-1	Neutral Gender Bathroom - Left	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1008-1	Neutral Gender Bathroom - Right	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1009-1	Girl's Locker Room Bathroom - Left	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1009-2	Girl's Locker Room Bathroom - Right	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1009-3	Girl's Locker Room	WF	App		5/19/2020	-	-	-	None	Removed from Service	-	-
1009-4	Girl's Locker Room Coach's Office	SK	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1009-5	Girl's Locker Room Custodial Closet	SS	N/A		5/19/2020	-	-	-	None	SIGN	-	-
1010-1	Exterior Hose Bib by Boiler Room	HB	App	55.6	5/19/2020				Additional Sampling Required			